

Manual

DDS

DE



Operating Instructions

CNC Milling Machines DS2000

valid from August 2013

Content

1.0 Legend

| | |
|--|---|
| 1.1 Explanation of safety message text | 4 |
| 1.2 Classification of signal words | 4 |
| 1.3 Symbols and hints | 4 |
| 1.4 Instruction symbols | 5 |

2.0 General safety messages

| | |
|---------------------------------|---|
| 2.1 Supplemental directives | 6 |
| 2.2 Safety messages | 6 |
| 2.3 Intended use of the machine | 8 |

3.0 General information

| | |
|----------------------------|----|
| 3.1 About this manual | 9 |
| 3.2 Machine components | 10 |
| 3.3 Technical data | 11 |
| 3.3.1 Basic system | 11 |
| 3.3.2 Rotary axes | 11 |
| 3.3.3 Spindle 13 | 12 |
| 3.3.4 Tool changer | 12 |
| 3.3.5 Controller | 12 |
| 3.4 Manufacturing software | 13 |
| 3.5 Scope of delivery | 14 |

4.0 Installation

| | |
|-----------------------------------|----|
| 4.1 Placement | 15 |
| 4.2 Setting up the machine | 16 |
| 4.3 Connecting the compressed air | 17 |
| 4.3.1 Connecting the service unit | 18 |
| 4.3.2 Setting the air pressure | 19 |
| 4.4 Connecting the air extraction | 19 |
| 4.5 Software installation | 20 |

5.0 Running the machine

| | |
|-------------------------------------|----|
| 5.1 Operating the machine | 22 |
| 5.2 Air extraction | 22 |
| 5.3 Synchronous spindle SFS 300P | 23 |
| 5.4 Tools | 23 |
| 5.5 Changing the blanks | 25 |
| 5.6 Procedure after a power failure | 26 |

6.0 Maintenance and cleaning

| | |
|---------------------------------|----|
| 6.1 Internal cleaning | 27 |
| 6.2 Collet chuck cleaning | 28 |
| 6.3 External cleaning (housing) | 29 |
| 6.4 Maintenance compressed air | 30 |
| 6.5 Calibration | 31 |
| 6.6 Maintenance table | 32 |

7.0 Disposal

33

Legend

1.1 Explanation of safety message text



General warning text. Failure to comply with the information given in this text can lead to serious injury.



Nature and source of a hazardous situation
Possible consequences!
● Advice to avoid the hazardous situation

1.2 Classification of signal words



DANGER indicates a hazardous situation which, if not avoided, will result in death or serious injury.



WARNING indicates a hazardous situation which, if not avoided, could result in death or serious injury.



CAUTION indicates a hazardous situation which, if not avoided, could result in minor or moderate injury.



NOTICE is used to address practices not related to physical injury. It indicates situations that can lead to material damage of the product or the environment.

1.3 Symbols and hints



background information



list



Operating instructions and other important information



Information to make work easier

Legend

1.3 Instruction symbols

| | |
|------------|---|
| ! | requirement |
| M1. | first action (M stands for manually) |
| S2. | second action in the software (S stands for Software) |
| M3. | third action (M stands for manually) |
| = | result |

2.1 Supplemental directives



Read this manual before you start the machine. Follow the listed safety messages to avoid risks and possible major injuries.

The users have to be informed about the intended use of the machine (page <?>). The safety messages indicated in this document have to be followed.

Check the machine and especially the protective devices for possible damages. Damaged safety devices or parts thereof must, if not stated otherwise in the user manual, be repaired or replaced by authorised service personnel.



Besides a maintenance of the machine is executed, it may only be operated with a closed front cover and with the safety interlock being shut. It is forbidden to disable the present safety devices or to set them out of use.

Keep children and animals away from the machine. Don't leave the machine running unattended, if other people have access to the machine. Use of the machine in maintenance mode may only be done by service personnel, that is trained by DentaSwiss to use the machine in maintenance mode.

Please be aware of the information about the choice of tools and the adjustment of tool parameters (see chapter 5.4).

2.2 Safety messages



Use of damaged cables

Danger to life due to an electric shock!



- Disconnect the machine from any electrical source and prevent the machine from being restarted.
- Contact the service department.
- Replace damaged cables only with original spare parts.

Troubleshooting while the machine is running

Danger to life due to an electric shock!



- Consult the service department, before you clear the malfunction on your own.
- Disconnect the machine from any electrical source and prevent the machine from being restarted.

General safety messages

WARNING

Operation of the machine in maintenance mode with open front cover
Risk of injury through cuts and bruises! Hazards through ejected chips!



- Use of the machine in maintenance mode may only be done by service personnel, that is trained by DentaSwiss to use the machine in maintenance mode.
- Don't grasp into the working chamber, while the machine is moving and while the milling job is processed.
- All persons within reach of the machine have to wear protective glasses when the machine is run with an open front cover.

WARNING

Processing harmful material
Respiratory diseases due to inhalation of harmful materials!

- Process material only when the air extraction is running.
- Only use suited materials, that are harmless when the air extraction is working.
- Use a suction device with an extra-fine particle filter.

WARNING

Loud noise from the machine
Hearing damage due to loud noise!



- Change the milling conditions. Ensure that the workpiece is fixed properly and check the values for the rotational speed, the cutting depth, the feed rate and the tool endurance. Also check the material you use.
- Change the tools regularly.
- Wear ear protection during processing, if loud noises can't be avoided.

WARNING

Open pneumatic connections
Danger through loose pneumatic parts conducting compressed air!

- Separate the machine from the compressed air supply.
- Consult the service department.

CAUTION

Disorder in the working environment
Trip hazard!



- Keep the working environment clean.
- Store the extra equipment like the vacuum cleaner or the wet grinding module in a safe place.

General safety messages

CAUTION

Ergonomics in the working environment
Subsequent damage due to constant malposition!



- Adjust the working environment ergonomically.
- Pay attention to keep the seat height, the monitor position and the exposure to light ideally.

CAUTION

Inserting milling tools
Cuts through sharp tool cutting edges!

- Grab milling tools only at the shaft, not at the tool tip.
- Take care not to cut yourself or others while handling with the tool.

2.3 Intended use of the machine

The machines of the type CAM 5-S1 Impression have been designed for easy to medium milling works in the field of dental technology. It has to be considered that the machine cannot withstand all powers that can possibly occur during operation.

The machines are designed to process the following materials:

- wax
- most of the plastic materials (e.g. PMMA)
- composites
- zirconium oxide
- non-precious alloys (CoCr - based)

The machine can get damaged, if it is used for another purpose than described above. The protective devices may not be avoided or turned off.

The instructions of this manual have to be followed and the maintenance procedures have to be executed as described.

The machine may only be operated with original equipment from DentaSwiss or with authorised equipment, to keep up the safety of the product and the warranty of the machine. The user carries the risk of damage to the machine if non-authorised equipment is used.

The warranty expires, if you modify the machine or take off the housing without a written agreement of the DentaSwiss service department.

General information

3.1 About this manual

This manual will enable you to use the dental milling machine CAM 5-S1 Impression as well as the accessory equipment safely and reliably. In this manual we want to advise you especially about the possible sources of danger that may come from the systems and to emphasise the correct use of the systems. Accordingly, we request you to read this manual attentively and to follow the advice given.

Keep this manual near the machine and ensure that everybody, who is working with the machine, has access to this manual.

- ① We appreciate every feedback and suggestion for improvement, so that we can continuously improve our product and the associated documentation. If you have questions or suggestions, please refer to your reseller.

3.2 Machine components

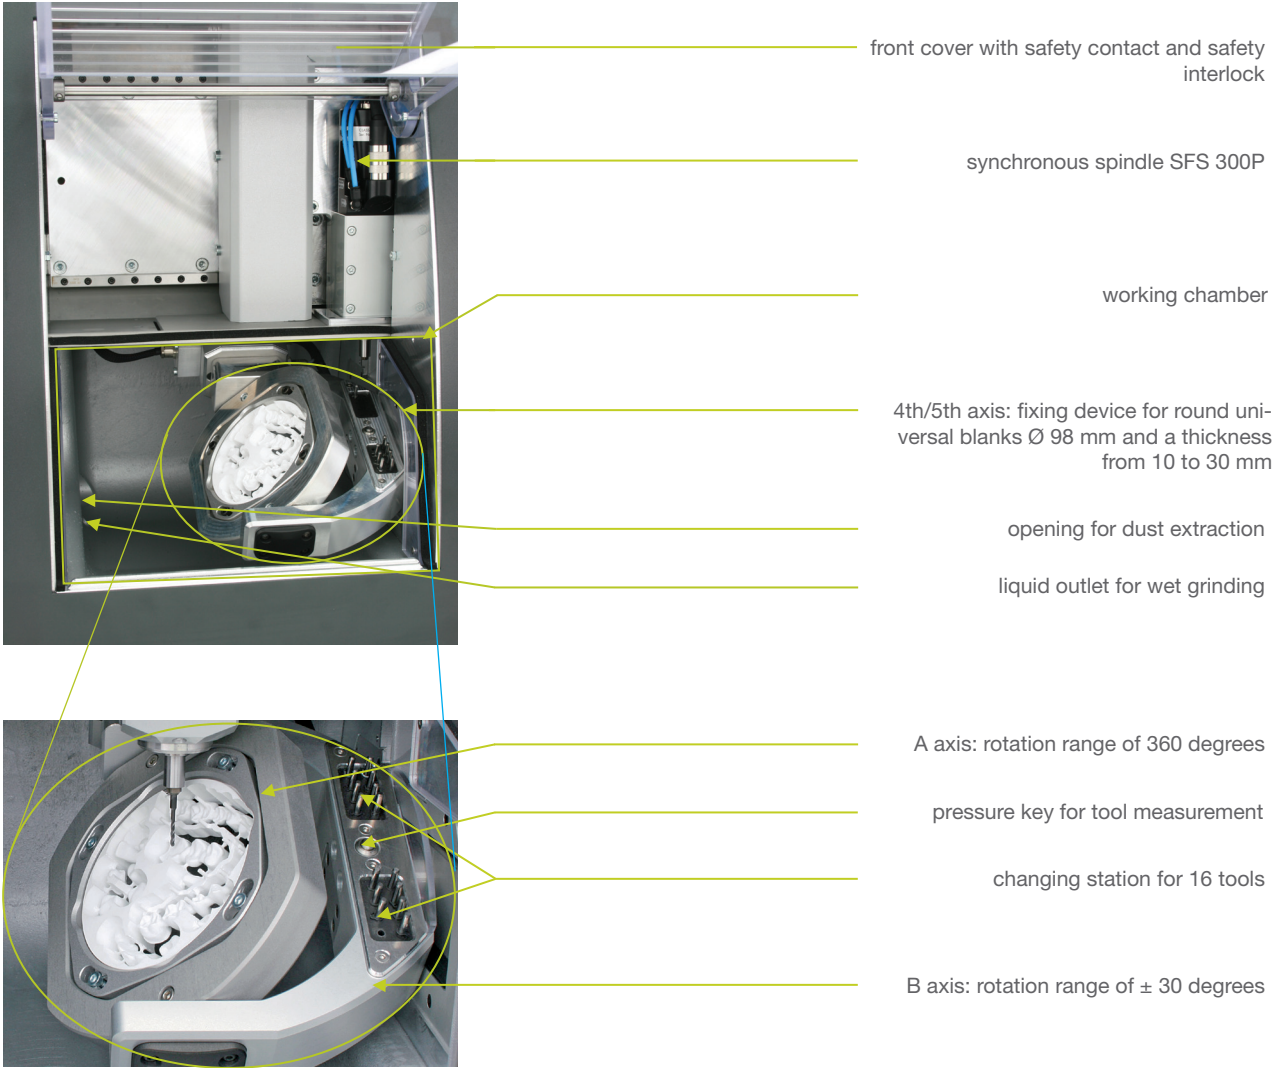


Illustration 1: Machine components DS2000

General information


3.3 Technical data

3.3.1 Basic system

- dimensions (W/D/H): approximately 490 x 445 x 540 mm
- five-axes mechanism; positioning range (x/y/z): 140 x 98 x 76 mm
- precise ball screw spindles for the 3 linear axes with 4 mm pitch
- repetition accuracy ± 0.003 mm
- complete housing of working chamber with closable front cover including a front lid switch and safety interlock
- working chamber illumination
- prepared air extraction option through hose connection sleeve and switching output at the side of the housing (requirements: external vacuum cleaner)
- underpressure sensor for monitoring the air extraction
- prepared wet grinding option through air extraction opening and switching output at the side of the housing (requirements: wet grinding module by DentaSwiss)
- blank dimensions: $\varnothing 98.5$ mm (± 0.2 mm), with groove
- blank thickness: 10 mm to 30 mm
- weight: approximately 75 kg
- maximum compressed air consumption of about 80 litres per minute

3.3.2 Rotary axes

- rotary axes free from backlash with Harmonic-Drive[®] mechanism
- rotational angle: 360 degrees (A axis), ± 30 degrees (B axis)
- automatic measurement of rotary axes and automatic axis compensation for exact results
- integrated fixing device for round universal blanks

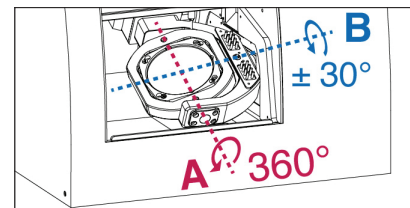

General information


3.3.3 Spindle

- synchronous spindle with rotational speeds up to 60,000 RPM
- nominal power under continuous load (S1): 300 Watts
- maximal power (Pmax): 600 Watts
- 4-fold bearing
- hybrid ceramic ball bearings
- pneumatic collet chuck 3 mm
- 3 liquid nozzles for wet grinding
- cone cleaning



3.3.4 Tool changer

- automatic tool changer for 16 tools
- automatic tool length detection and tool breakage monitoring via pressure key
- diamond-coated tools can be used
- compressed air monitoring

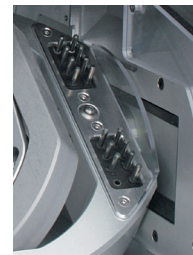

3.3.5 Controller

- five-axis microstep controller
- simultaneous control of 5 axes
- great smoothness and high accuracy due to microstep operation
- high processing speed due to exponential acceleration slopes and automatic change-over to full step mode
- look-ahead feature for continuous velocity along the path
- optional Ethernet interface
- included control software for a comfortable output of the data which has been generated by the post processor
- speed limitations: 0.003 mm/s up to 55 mm/s


General information

3.4 Manufacturing software

- ① To calculate the milling paths you need to create a file in the STL format from your CAD program. All important parameters for the respective material are included in the software package DentalCAM. Operation with external CAM programs is possible, if there is a post processor for the respective program. If you want to use an external CAM software contact DentaSwiss to clarify, if there is already a post processor for your CAM software or if a new post processor has to be written for your program. The machine is controlled with the included software DentalCNC.
- ① For operating the manufacturing software, please refer to the corresponding software manual.

3.5 Scope of delivery

Illustration 2: Scope of delivery DS2000

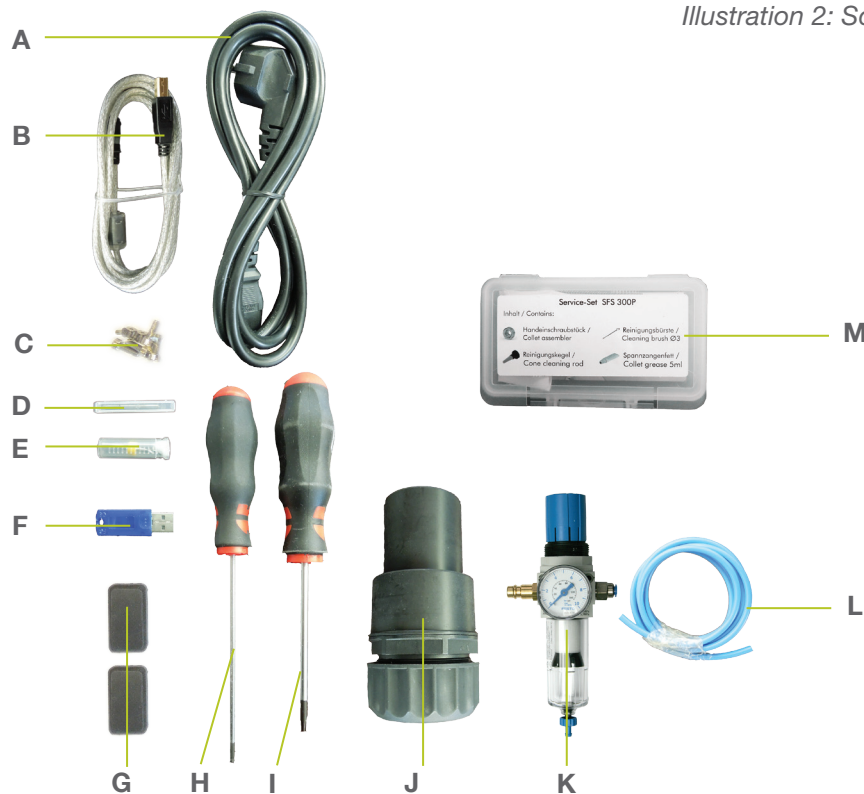

- A 1 power supply cord
- B 1 USB connection cable
- C 1 set of replacement screws for the tool changer plate and the fixing device
- D 2 measuring pins
- E 1 drill 2.8 mm for the tool changer inserts
- F 1 USB dongle
- G 2 tool changer rubber inserts
- H 1 hexagon socket screw key 3 mm to change the blanks in the fixing device
- I 1 key for emergency release of the front cover
- J 1 hose connection for external vacuum cleaner
- K 1 service unit for compressed air
- L pneumatic hose Ø 6 mm
- M 1 spindle service set
- CNC machining system DS2000 (not pictured)
- manual DS2000 (not pictured)
- software manual (not pictured)
- software license DentalCAM including control software – current version downloadable at <http://www.dentaswiss.com/CAMSW>

i If you are using an external CAM software only the control software DentalCNC is included in the scope of delivery.

Installation

4.1 Placement

The following requirements have to be considered to choose the right machine location:

- firm and even surface, has to carry the weight of the machine (approximately 75 kg)
- room temperature ideally between 18° Celsius and 25° Celsius
- relative air moisture maximum 80 %, non-condensing
- alternating current source with 90 – 240 V and 50 – 60 Hz
- The machine needs to have an adequate distance to the wall on the right side of the machine (seen from the front), so that the ventilation holes are not blocked (at least 10 cm distance). On the left side and on the back of the machine needs to be enough distance, so that you can reach all machine connections easily.

NOTICE

Plug the machine's power cord in a separately fused circuit current or ensure that no devices are connected that cause heavy voltage fluctuation when switched on (air compressor, suction unit). Heavy voltage fluctuations can disturb the control and cause a failure of the system. Don't use multiple sockets for the power supply of the machine.



Illustration 3: Connection panel DS2000

4.2 Setting up the machine

M1.

Unwrap the milling machine. Please keep the packaging for possible further service shipments.

M2.

Connect the service unit via the standard pneumatic connection plug with your compressed air supply (see also chapter 4.3)

Important

The pneumatic hose (blue hose) must be inserted in the blue marked connection (on the top left of the connection panel, see Illustration 3). It may not be inserted in the stainless steel connection, since the machine doesn't start without compressed air!

M3.

Check the displayed air pressure value on the manometer. If the pressure is not between 6 and 8 bar, reset the pressure value (see chapter 4.3.2).

M4.

Connect the manufacturing computer to the machine via the USB connection respectively via the Ethernet port.

M5.

Put the vacuum hose with the hose connection in the air extraction opening at the side of the machine (see also chapter 4.4).

M6.

Insert the dongle in a USB port of the manufacturing computer.

M7.

Connect the power cord to the machine.

Important

M8.

Plug the machine's power cord in a separately fused circuit current or ensure that no devices are connected that cause heavy voltage fluctuation when switched on (air compressor, suction unit). Heavy voltage fluctuations can disturb the control and cause a failure of the system. Don't use multiple sockets for the power supply of the machine.

The front cover is closed.

M9.

Start the machine with the main power switch.

Installation

4.3 Connecting the compressed air

The spindle SFS 300P needs a pneumatic connection. The spindle uses the compressed air to control the collet chuck during the automatic tool change. It is also used to produce sealing air, that prevents dirt from entering into the spindle. The maximum air consumption of the machine is about 80 litres per minute.

NOTICE

The scope of delivery contains a service unit for the compressed air supply. You can use it to regulate the incoming compressed air to the machine. The built-in water separator containing a 5-micron fine filter prevents moisture or dirt from getting into the machine.

Important

The incoming compressed air has to be dry and free of oil according to ISO 8573-1, since the water separator can filter only small amounts. Wet compressed air can lead to bearing damage and electrical damage of the spindle.

Air purity according to ISO 8573-1

| | | |
|---------------------|---------|--|
| Solid contamination | class 3 | Filtration degree better than 5 microns for solids |
| Water content | class 4 | Maximum pressure dew point +3 °C |
| Overall oil content | class 5 | Maximum oil content 1 mg/m ³ |

The compressed air supply has to provide at least 6 bar during operation of the machine.

4.3.1 Connecting the service unit

The service unit can be mounted to the housing or connected directly to the compressed air supply. You need to make sure that the service unit is visible during operation so that a regular control is possible. In the following text the mounting to the housing is explained. If you connect the service unit directly to the compressed air supply, please regard only the steps M3. to M5.

NOTICE

The service unit has to be installed vertically (see Illustration 4). The water separator doesn't work, if the service unit is not installed vertically!

M1

Remove the two blind screws under the vent holes at the side of the milling machine.

M2

Mount the service unit vertically with the included cylinder head screws (see Illustration 5 on page 23).

CAUTION

Connect the maintenance unit to the machine before you connect the maintenance unit to the compressed air supply. Otherwise risk of injury occurs through leaking compressed air or lashing pneumatic hoses.

M3

Cut a piece of the delivered pneumatic hose (Ø 6 mm) in the desired length.

M4

Connect the pneumatic connection on the right side of the maintenance unit to the pneumatic connection of the machine.

M5

Connect the compressed air supply to the standard pneumatic connection plug on the left side of the maintenance unit.

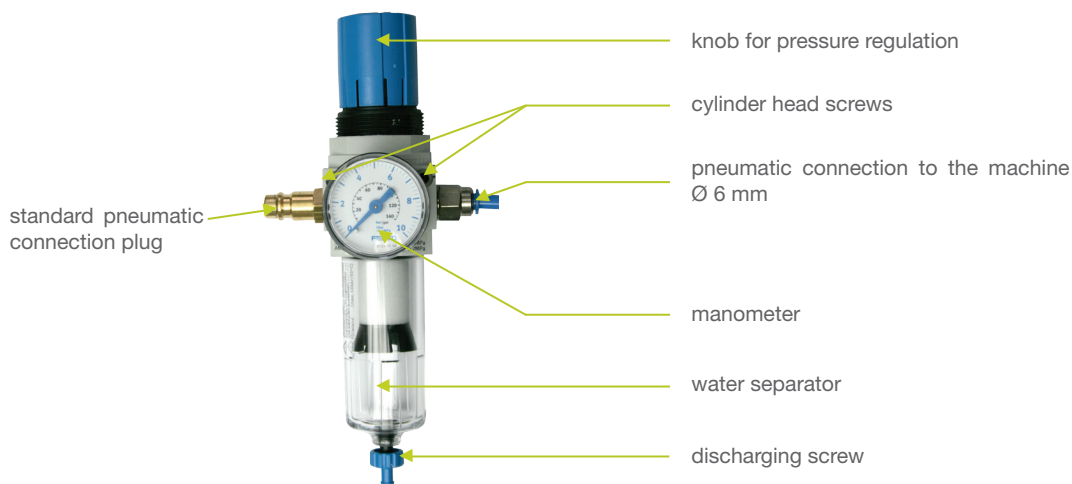


Illustration 4: Maintenance unit: air pressure setting and control

Installation

4.3.2 Setting the air pressure

Hint

Setting the air pressure is only necessary, if the displayed pressure on the manometer is not between 6 and 8 bar.

The maintenance unit is connected to your compressed air supply.

M1

Pull the knob on top of the maintenance unit a little bit.

M2

Set the pressure (turning the knob toward “+” increases the pressure, turning the knob toward “-” decreases the pressure), until the displayed value is at least 6 bar.

M3

Push the knob down again.

The air pressure is set and cannot be changed inadvertently.

4.4 Connecting the air extraction

Important

The vacuum cleaner that you use has to be suitable for your application (extra-fine particle filter for processing harmful material etc.).

Empty the dust bag of your air extraction regularly and replace the possibly existing extra-fine particle filter in regular intervals.

Read the manual of your air extraction carefully and follow the advice given.

M1

Plug the hose connection with the air extraction hose in the opening at the side of the machine.

M2

Connect the optional switching unit to the switching output at the side of the machine (see Illustration 3).

M3

Connect the air extraction to the power supply respectively connect it to the switching unit and connect the switching unit to the power supply (see Illustration 5).

4.5 Software installation

Installation and operation of the control software and the milling machine is only possible when the dongle is connected to the manufacturing computer.

The manufacturing computer is running and connected to the machine.

S1

Insert the delivered dongle in a USB port of the manufacturing computer.

S2

Download the installation file of the software from <http://www.dentaswiss.com/CAMSW> in the download sector.

S3

Unzip the downloaded file.

S4

Start the file setup.exe and follow the advice of the installation program.



Further advice for the software installation is given in the software manual.

Please check our website regularly, if new software updates are available.

Installation

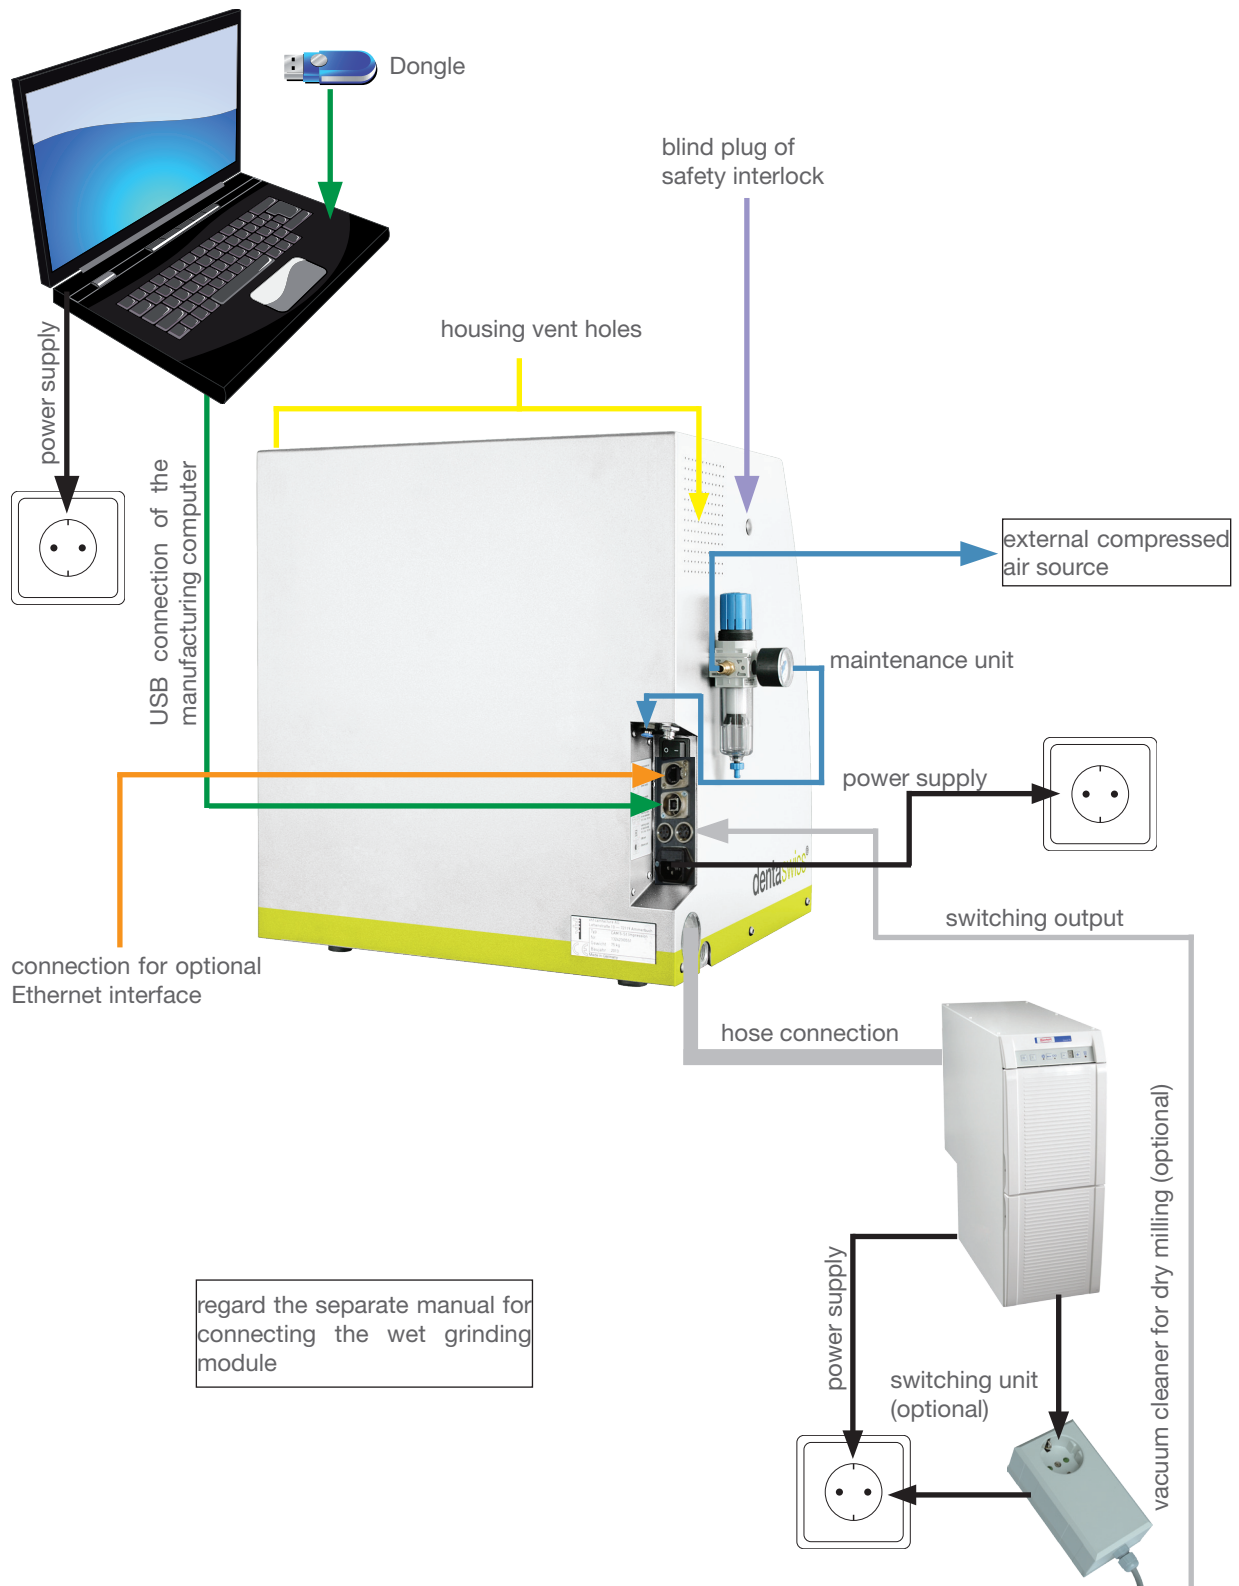


Illustration 5: Overview of the machine connections DS2000

Running the machine

5.1 Operating the machine

Make sure that all cables and hoses have been connected correctly and turn on the machine with the main power switch on the side of the machine.

For a milling job you only need the blanks which you want to use as well as the appropriate tools. As the machine is operated through the software, you can find further details on handling the machine in the software manual.

The machine is equipped with a safety contact and a safety interlock for the front cover. When the safety interlock is shut, the front cover cannot be opened during a milling operation.

Important

The machine may only be operated when the safety interlock is shut.


5.2 Air extraction

NOTICE

Operate the machine only with the air extraction turned on and make sure, that the air extraction opening is not blocked. If the air extraction is not working properly, material chips can reach the sensitive parts of the machine like the bearings or the ball screws and damage them!

The model CAM 5-S1 Impression is prepared for air extraction with an external industrial vacuum cleaner. For this purpose, the machine is equipped with an opening for the hose connection as well as a switching output for automatically switching the suction unit at the housing side.

For operating the air extraction unit you need the provided hose connection and an external vacuum cleaner.

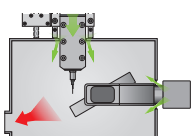

The machine is equipped with an underpressure sensor for monitoring the air extraction. Make sure, that the air extraction is running and the air extraction opening is not blocked. The integrated working chamber sealing air concept prevents milling dust and chippings from entering into the mechanics and electronics of the machine and reduces wear and maintenance efforts.

Running the machine

5.3 Synchronous spindle SFS 300P

⚠ WARNING

For the operation, installation and maintenance of the spindle follow the regulations for the prevention of accidents. Improper handling or operations differing from the intended use of the machine greatly reduce the safety of usage!

NOTICE

The synchronous spindle SFS 300P is a high precision device that may never be subject to any form of raw force like strikes!

Keep in mind that the values for the immersion depth and the feed rate are not too high during operation. This can lead to damage of the workpiece and tilting of the tool. By that the spindle can take irreparable damages. If you work with the DentalCAM software, the software automatically calculates the optimal parameters.

Do not use unbalanced tools (single tooth cutters, gravers) at high rotational speeds. Such an imbalance can be heard by a loud running noise and puts a great strain on the ball bearings of the spindle.

5.4 Tools

⚠ CAUTION

Never touch a tool at the tip. Otherwise cutting injuries may occur.

In order to insert or exchange tools move the machine to the basic position using the software. Insert the tool with the tip downwards into the tool changer inserts. Make sure that you put the tool in the position, that you assigned in the software.

Hint

Usage of original tools is recommended, since the tools are designed by DentaSwiss especially for the machine and the designated milling operation.

Important

The tools used for Cobalt-chrome blanks are shorter than tools for other materials. Therefore only Cobalt-chrome blanks with a thickness of maximal 16 mm can be used on the machine!

If you should use tools from other manufacturers, please regard the following specifications.

For storing the tool in the tool changer an unmachined shank with a length of at least 7 mm is required.

NOTICE

A retaining ring has to be installed as a stop ring into the existing slot. Install only retaining rings according to DIN 471-A3!

Make sure that the tools are put straight in the tool changer. All inserted tools must suit the positions stored in the software. Otherwise the tool or the workpiece may get damaged.

Only tools with a shank diameter of 3 mm may be used. Don't use tools, where the cutting edge diameter is higher than the shank diameter (\varnothing 3 mm). Don't use tools with a cutting edge diameter higher than 2.5 mm for the tool changer, otherwise the tool changer inserts get damaged.

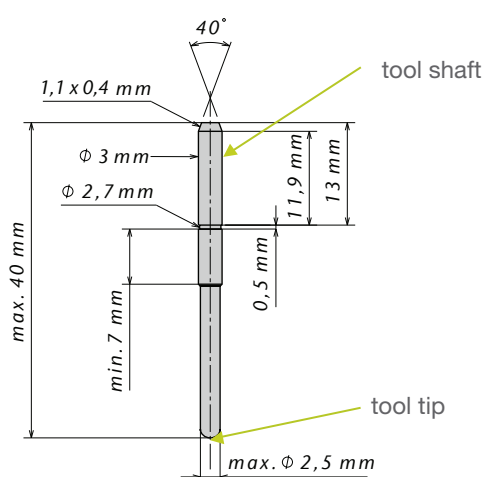


Illustration 6: Tool dimensions for DS2000

Running the machine

5.4 Changing the blanks

The blanks are tightened in the fixing device by a fixing disc (see Illustration 7).

S1.

Move the machine to the basic position.

M2.

Loosen the four screws at the fixing disc with a hexagon socket screw key (3 mm), until the fixing disc can be moved.

M3.

Turn the fixing disc and take it off. You can leave the screws in the fixing device.

The blank can be changed.

=

M4.

Insert the fixing disc and turn it until the screws are in the middle of the holes.

M5.

Tighten the screws crosswise.

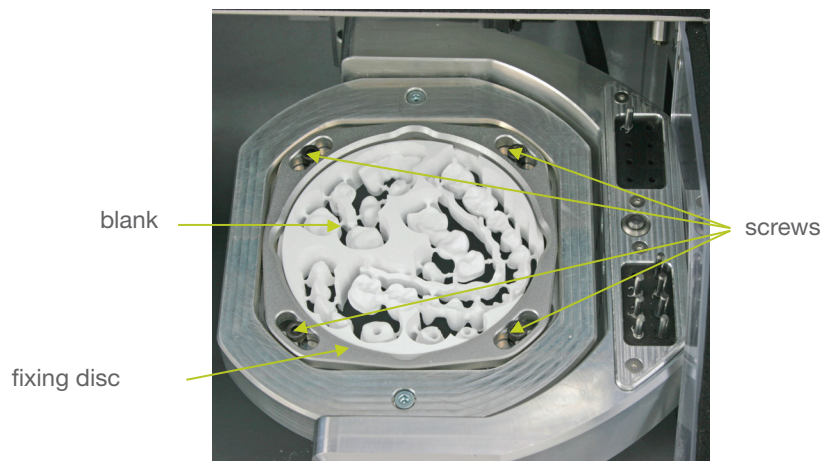


Abbildung 7: Fixing device DS2000

Running the machine

5.6 Procedure after a power failure

If there is a short power failure, it is enough to turn the machine back on again. In this case the machine references and moves to the basic position.

If there is a longer power failure or a malfunction of the power wire you can open the safety interlock with an emergency key to take the blank out of the machine.

CAUTION

Turn off the machine and disconnect it from any electrical source, in case the power is available again. By that the machine cannot reference, while a blank is removed. The machine referencing at that point can lead to bruises.



The machine is switched off and separated from any electrical source.

M1.

Remove the blind plug on the left side of the housing.

M2.

Open the safety interlock by turning the key counter-clockwise until the end position.



The front cover can be opened and the blank can be removed.



Blank is removed.



The front cover is closed.

M3.

Shut the safety interlock by turning the key clockwise until the end position.



If you don't shut the safety interlock again, the machine cannot start a new milling job after it is switched on again.

M4.

Insert the blind plug again.

M5.

Connect the machine to the power supply and turn on the machine at the main power switch.

Maintenance and cleaning

6.1 Internal cleaning

NOTICE

Never use compressed air for internal cleaning since material chips can reach the sensitive components like the linear guides or the spindle bearings.

Clean the machine regularly to prevent material chips from getting to the linear guides and other sensitive machine parts.

Use only a vacuum cleaner or a brush for internal cleaning.

Hint

Clean the fixing device and the measuring key as well with a vacuum cleaner and a brush. If you only use a brush for cleaning, turn on the air extraction in the software, so that the chips are removed instantly.

6.2 Collet chuck cleaning

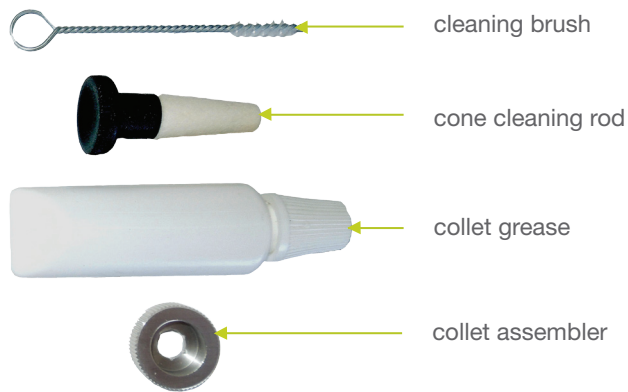


Illustration 8: Scope of delivery spindle service se



The collet chuck cleaning is explained in detail in the brief instruction of the service set.

NOTICE

Never use compressed air to clean the collet chuck. Otherwise the spindle bearings can get damaged.

Please clean the collet chuck with the components of the spindle service set once a week.

S1.

Click the button „spindle maintenance“ in the CNC module of the software.

S2.

Confirm the message to open the collet chuck.

M3.

Open the front cover.

M4.

Unscrew the collet chuck with the collet assembler of the spindle service set.

Maintenance and cleaning

M5.

Clean the inner cone of the spindle with the cone cleaning rod of the spindle service set.

M6.

Clean the collet chuck with the cleaning brush of the spindle service set. Pay attention that the seals in the collet chuck don't fall out.

M7.

Take a small amount of the collet grease and put it on the flanks of the collet chuck.

NOTICE

Pay attention that the collet grease doesn't get into the slits of the collet chuck. Only use the delivered collet grease of the spindle service set, so that the spindle doesn't get damaged.

M8.

Screw the collet chuck into the spindle with the collet assembler until you reach the end position.

M9.

Click the button „spindle maintenance“.

6.3 External cleaning (housing)

The cleaning of powder-coated surfaces should generally be done with a soft dry cloth first. If pollution cannot be removed this way, the cloth can be moistened and a pH-adjusted cleaner can be used if necessary.

Important

Basically any contact between the powder coatings and alkaline or acid substances has to be avoided. Especially metallic powders show a high sensitive reaction. Please take special care of the affixed machine labels, so that you don't remove them while cleaning the housing. They are highly sensitive to rubbing and strong detergents.

Hint

If the usage of a special cleaner is necessary to eliminate certain pollutions we recommend to check the applicability of the cleaner at a hidden place of the housing first.

6.4 Maintenance compressed air



Please check regularly if there is liquid in the water separator of the service unit and empty it if necessary by opening the discharging screw (see 4.3 on page 30). The condensate will be blown out under pressure. Condensate in the separator usually points to compressed air being not dry enough. Please note our guidelines for air purity in chapter 4.3.

Important

In case of strong dirt accumulation the micro-filter element in the water separator has to be cleaned or exchanged. A strongly polluted filter element may cause a loss of working pressure.

M1.

Separate the machine from the compressed air source.

M2.

Unscrew the bowl of the water separator.

M3.

Turn out the supporting spring under the filter element.

M4.

Pull out the filter.

A new filter element is available as spare part at DentaSwiss.

M5.

Insert the new or cleaned filter element and reassemble the water separator.



If the compressed air complies with the standard ISO 8573-1 (see chapter 4.3), the filter element usually doesn't have to be exchanged at all. If the filter element is polluted, please control the air purity of your compressed air.

Maintenance and cleaning

6.5 Calibration



The machine is already calibrated on delivery. As long as your milling results are correct, there is no need for a further calibration. If your results should become inaccurate, a calibration could become necessary. In such a case, please contact a service technician before recalibrating the machine. A calibration is time consuming and can degrade your milling results in the worst case, if it is not done correctly. Please try to change the milling conditions first. Check the fixation of the workpiece, the rotational speed, the depth of immersion, the feed rate or the material of the workpiece, before you calibrate the machine.

6.6 Maintenance table

| Maintenance table | | | |
|---|---------------------------------------|--|---|
| Component | Recommended interval | Procedure / Utensils | Prerequisites / Comments |
| <ul style="list-style-type: none"> Working chamber Fixing device Measuring key | once per day, if necessary more often | Cleaning with vacuum cleaner and brush (see chapter 6.1) | working chamber polluted Never use compressed air! |
| <ul style="list-style-type: none"> Collet chuck | once a week, if necessary more often | Removal and cleaning of the collet chuck (see chapter 6.2) | untrue spindle run, bad milling results |
| <ul style="list-style-type: none"> Housing | as necessary | Cleaning with cloth and possibly detergents (see chapter 6.3) | - |
| <ul style="list-style-type: none"> Calibration | only if necessary | Calibration with help of the software (see software manual) | bad milling results after all other possibilities are covered (see chapter 6.5) |
| <ul style="list-style-type: none"> Service unit | only if necessary | Check compressed air source Clean or replace filter element (see chapter 6.4) | Condensate in the water separator, filter element polluted |

Disposal

7.0 Disposal



Disposal of the machine is taken over cost-free by DentaSwiss. The customer/user bears the costs for disassembly, transport and packaging of the machine. Contact DentaSwiss in advance of a final disposal to go through the further procedure.

Please regard the national and the local laws of the disposal location, if you dispose the machine on your own.



www.biodenta.com

Biodenta Regional Hubs

Americas

usa@biodenta.com

11 Firstfield Rd
Gaithersburg, MD 20878
USA

Tel +1 240 482 8484
Fax +1 301 215 6933

Europe, Middle East & Africa

emea@biodenta.com

Tramstrasse 16
9442 Berneck
Switzerland

Tel +41 71 747 11 11
Fax +41 71 747 11 12

Asia & Pacific

apac@biodenta.com

2F, No.51, Sec. 4, Zhongyang Rd.,
Tucheng Dist., New Taipei City
236, Taiwan

Tel +886 2 2267 3937
Fax +886 2 2267 3973